# SPEED FACER™ ODF 30 - 120

MOUNTING RANGE: 9.2 - 120.5 inches (487.6 - 3060.7 mm)

01 | 2019 ODF30-120

### POWER. SPEED. EASE OF USE.

The OD Mount SPEED FACERS deliver the power and speed needed to get the job done efficiently and cost-effectively.









### POWERFUL PRECISE MACHIN-ING PERFORMANCE

Up to 3 hp pneumatic motor provides more power and speed resulting in higher metal removal rates to get the job done fast.

Optimized drive reduction provides the speed range required to use carbide or HSS tooling, for added flexibility and performance.

Infinitely variable feed rates from 0.001-0.032 inch/rev (0.025 - 0.813 mm/rev) allows operational flexibility for higher metal removal and variable surface finish requirements.

Multiple feed trippers to actuate the adjustable feed unit. This allows aggressive feed rates for maximum metal removal as needed.

### **VERSATILITY AND EASE OF USE**

Select from 10 models sized to machine flanges up to 30.5, 40.5, 50.5, 60.5, 70.5, 80.5, 90.5, 100.5, 110.5, or 120.5 inches (774.7, 1028.7, 1282.7, 1536.7, 1790.7,

2044.7, 2298.7, 2552.7, 2806.7, or 3060.7 mm) in diameter.

Tool head and tool bit rotate 360° independently to any angle allowing optimal tool bit positioning and flexibility to create a variety of cuts including chamfers, o-ring grooves, square shoulders, and other angled surfaces.

Back-facing attachment option provides even more flexibility in machining operations were there are bridge obstructions or when machining flanges on the back side of pipe flange.

Removable feed trippers allows for multiple mounting positions maximizing ability to avoid obstructions.

Setup fingers and leveling feet allows for quick and easy setup and alignment of the machine reducing crane time.

Reversible pneumatic motor can be installed from either the top or bottom of the machine depending on obstructions or operating mode.

Custom-built crate allows for expanded shipping options and reduces exposure to inclement weather and damage on-site or in transit

Cutting tools available upon request eliminates outsourcing. Tool holder can accept up to 0.75 inch (19.1 mm) tooling.

### **SAFETY**

Auto-feed system keeps operators hands safe from moving parts and keeps the job running smoothly.

Bearing guard keeps chips and debris out of the bearing and belt drive system protecting the operator from exposed pinch and entanglement hazards.

Low-pressure safety interlock system prevents unintended re-starts after loss of supplied air pressure.

E-stop for quick stops & controlled re-starts. CE Certified



# **SPECIFICATIONS**



### SMALL SPEED FACERS (MOUNTING RANGE: 19.2 TO 80.5)

	ODF30	ODF40	ODF50	ODF60	ODF70	ODF80			
Machine Performance I	Ranges								
Mounting range	19.2 - 30.5 in. (488 - 775 mm)	29.2 - 40.5 in. (742 - 1029 mm)	39.2 - 50.5 in. (996 - 1283 mm)	49.2 - 60.5 in. (1250 - 1537 mm)	59.2 - 70.5 in. (1511 - 1791 mm)	69.2 - 80.5 in (1757 - 2044 mm)			
Mounting range w/feet extension	9.2 - 30.5 in. (234 - 775 mm)	19.2 - 40.5 in. (488 - 1029 mm)	29.2 - 50.5 in. (742 - 1283 mm)	39.2 - 60.5 in. (996 - 1537 mm)	49.2 - 70.5 in. (1250 - 1791 mm)	59.2 - 80.5 in (1503 - 2044 mm)			
Facing diameter range	0 - 30.5 in. (0 - 775 mm)	0 - 40.5 in. (0 - 1029 mm)	0 - 50.5 in. (0 - 1283mm)	0 - 60.5 in. (0 - 1537 mm)	0 - 70.5 in. (0 - 1791 mm)	0 - 80.5 in (0 - 2044 mm)			
Radial tool slide travel		14 in. (356 mm)							
Axial tool head travel	6 in. (152 mm)								
Feed rate (Adjustable)	0.001 - 0.032 inch/rev (0.025 - 0.813 mm/rev)								
Rotational Drive System	n								
Drive type	Pneumatic or Hydraulic - Belt Drive								
Turning arm speed range at max power	0 - 34 RPM	0 - 14.5 RPM	0 - 12 RPM	0 - 10 RPM	0 - 9 RPM	0 - 8 RPM			
Power input requirements	1.35 hp pneumatic motor requires 44 S CFM at 90 psi (1.25 cu.m./min at 6 bar)								
Weight		7							
Machine	1079 lbs (490 kg)	1330 lbs (603 kg)	1690 lbs (767 kg)	1930 lbs (875 kg)	2160 lbs (980 kg)	2820 lbs (1280 kg)			
Wooden crate	377 lbs (171 kg)	430 lbs (195 kg)	490 lbs (222 kg)	550 lbs (249 kg)	860 lbs (390 kg)	1100 lbs (499 kg)*			
Total shipping weight	1456 lbs (662 kg)	1760 lbs (798 kg)	2180 lbs (989 kg)	2480 lbs (1125 kg)	3020 lbs (1370 kg)	3920 lbs (1780 kg)			

<sup>\*</sup> Incline shipping frame

### LARGE SPEED FACERS (MOUNTING RANGE: 79.2 TO 120.5)

	ODF90	ODF100	ODF110	ODF120			
<b>Machine Performance F</b>	Ranges		·				
Mounting range	79.2 - 90.5 in (2011 - 2298 mm)	89.2 - 100.5 in (2265 - 2552 mm)	99.2 - 110.5 in (2519 - 2806 mm)	109.2 - 120.5 in (2773 - 3060 mm)			
Mounting range w/feet extension	69.2 - 90.5 in (1757 - 2298 mm)	79.2 - 100.5 in 89.2 - 110.5 in (2011 - 2552 mm (2265 - 2806 mm)		99.2 - 120.5 in (2519 - 3060 mm)			
Facing diameter range	0 - 90.5 in (0 - 2298 mm)	0 - 100.5 in (0 - 2552 mm)	0 - 110.5 in (0 - 2806 mm)	0 - 120.5 in (0 - 3060 mm)			
Radial tool slide travel		14 in.	(356 mm)				
Axial tool head travel	6 in. (152 mm)						
Feed rate (Adjustable)	0.001 - 0.032 inch/rev (0.025 - 0.813 mm/rev)						
Rotational Drive System	n						
Drive type	Pneumatic or Hydraulic - Belt Drive						
Turning arm speed range at max power	0 - 7.5 RPM	0 - 6.5 RPM	0 - 5.5 RPM	0 - 5 RPM			
Power input requirements	3 hp pneumatic motor requires 95 SCFM at 90 psi (2.69 cu.m./min at 6 bar)						
Weight							
Machine	3140 lbs (1433 kg)	3460 lbs (1569 kg)	3760 lbs (1707 kg)	4040 lbs (1835 kg)			
Incline shipping frame	1140 lbs (517 kg)	1260 lbs (572 kg)	1360 lbs (617 kg)	1460 lbs (662 kg)			
Total shipping weight	4280 lbs (1940 kg)	4720 lbs (2140 kg)	5120 lbs (2320 kg)	5500 lbs (2500 kg)			

All dimensions should be considered reference. Contact your H&S TOOL Representative for precision dimensions. Specifications are subject to change without notice. Acutal results for test data may vary depending on setup, machining conditions and machine maintenance There are no systems or components on this machine that are capable of producing hazardous EMC, UV or other radiation hazards. The machine does not use lasers nor does it create hazardous materials such as gasses or dust.

## **TOOL CONFIGURATIONS**





To order your **SPEED FACER**™, simply select the size of the machine.


Everything you need comes standard!

SPEED FACER™ - Includes complete machine assembly with mounting feet, wooden shipping crate (model ODF30 - ODF70) or incline shipping frame (model ODF80 - ODF120), low-pressure safety interlock system, 15 ft (4.6m) air hose, tool kit with cutting tools and operating manual.

Part Number	Model	Facing Diameter Range Up To			
88930	ODF30	30.5 in (774.7 mm)			
86870	ODF40	40.5 in (1028.7 mm)			
86980	ODF50	50.5 in (1282.7 mm)			
86990	ODF60	60.5 in (1536.7 mm)			
87000	ODF70	70.5 in (1790.7 mm)			
94770	ODF80	80.5 in (2044.7 mm)			
94780	ODF90	90.5 in (2298.7 mm)			
94790	ODF100	100.5 in (2552.7 mm)			
93050	ODF110	110.5 in (2806.7 mm)			
94850	ODF120	120.5 in (3060.7 mm)			

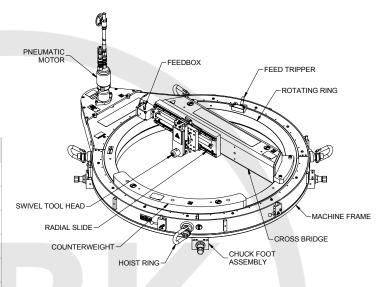

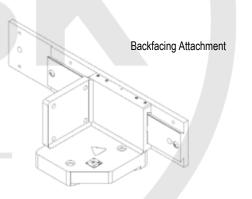

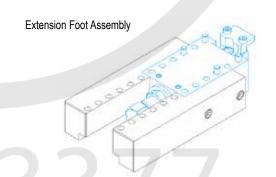

### SPEED FACER™ ACCESSORIES

87310 **Backfacing attachment** - reuses tool head and slide from machine.

87164 Extension chuck foot assembly - This is a single extension assembly for a chuck foot. Each extension extends the chuck foot 5 inches (127 mm) for a total of 10 inches (254 mm) in diameter. Four (4) extensions are required for the ODF30 and ODF40, eight (8) extensions are required for the

ODF40, eight (8) extensions are required for the ODF50, ODF60, ODF70 and ODF80, and twelve (12) extensions are required for the ODF90, ODF100, ODF110, and ODF120.

89201 Spacer chuck foot assembly - includes two 2 in (50.8 mm) spacers and two lengths of bolts for each foot...

# H&S APPLICATIONS

#### Industries

Oil & Gas Power Generation Shipbuilding

On-site Maintenance & Repair Industrial Manufacturing

### **Typical Applications:**

- · Pressure vessel flange facing
- Heat Exchanger flange facing
- · High pressure flange machining & repair
- · Machining back side of tube sheet
- Coupling repair

- Flange gasket surface repair
- · Crane pedestal production and repair

H&S TOOL a CLIMAX Company Web site: climaxportable.com


# **TEST DATA & DIMENSIONS**



### In-House Testing Performance Results

	ODF30		OD	F40	ODF50		ODF60		ODF70	
	Test 1	Test 2	Test 1	Test 2	Test 1	Test 2	Test 1	Test 2	Test 1	Test 2
Depth of cut	0.100 in (2.5 mm)	.008 in (.203 mm)	0.100 in (2.5 mm)	0.010 in (0.254 mm)	0.090 in (2.3 mm)	0.005 in (0.127 mm)	0.075 in (1.9 mm)	0.010 in (0.254 mm)	0.075 in (1.9 mm)	0.010 in (0.254 mm)
RPM	34	34	14.5	14.5	12	12	10	10	9	9
Feed	0.008 in/rev (0.203 mm/rev)	0.032 in/rev (0.813 mm/rev)	0.008 in/rev (0.203 mm/rev)	0.032 in/rev (0.813 mm/rev)	0.008 in/rev. (0.203 mm/rev)	0.032 in/rev. (0.813 mm/rev)	0.008 in/rev. (0.203 mm/rev)	0.032 in/rev (0.813 mm/rev)	0.008 in/rev. (0.203 mm/rev)	0.032 in/rev (0.813 mm/rev)
Dia. of cut	21-25 in (533 - 635 mm)	18-21 in (457 - 533 mm)			36.25 40.5 in (921 - 1029 mm)		47.25 - 50.7 in (1200 - 1288 mm)		59.25 - 63 in (1505 - 1600 mm)	
Tool type	Insertable carbide									
Finish	Ra 63	Ra 250	N/A	250 Ra	N/A	250 Ra	N/A	250 Ra	N/A	250 Ra

### SPEED FACER™ DIMENSIONS (MOUNTING RANGE: 19.2 TO 70.5)

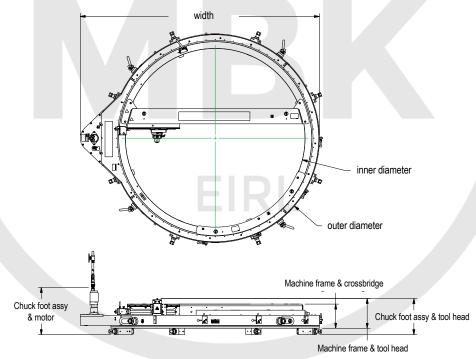


	ODF30	ODF40	ODF50	ODF60	ODF70			
Machine dimensions								
Machine width	54.1 in. (1373.1 mm)	64.1 in. (1627.1 mm)	74.1 in. (1881.1 mm)	84.1 in. (2135.1 mm)	94.1 in. (2389.1 mm)			
Machine inner diameter	30.6 in. (777.2 mm)	40.6 in. (1031.2 mm)	50.6 in. (1285.2 mm)	60.6 in. (1539.2 mm)	70.6 in. (1793.2 mm)			
Machine outer diameter	42.0 in. (1066.8 mm)	82.0 in. (1320.8 mm)	62.0 in. (1574.8 mm)	72.0 in. (1828.8 mm)	82.0 in. (2082.8 mm)			
Height between:								
Chuck foot assy & motor	18.3 in. (464.8 mm)	18.3 in. (464.8 mm) 18.5 in. (470.5 mm)						
Machine frame & crossbridge	9.3 in. (235.6 mm)	9.5 in. (241.3 mm)						
Machine frame & tool head	13.5 in. (341.9 mm)	13.5 in. (341.9 mm) 11.7 in. (296.8 mm)						
Chuck foot assy & tool head	16 in. (405.4 mm)	(405.4 mm) 14.2 in. (360.3 mm)						
Shipping dimensions								
Wooden crate	49.5 x 62.5 x 22 in.	59 x 71 x 21.25 in.	74 x 74 x 21.25 in.	84 x 84 x 21.25 in.	92 x 92 x 21.25 in.			
WxDxH	(1257 x 1588 x 559 mm)	(1499 x 1803 x 540 mm)	(1880 x 1880 x 540 mm)	(2134 x 2134 x 540 mm)	(2337 x 2337 x 540 mm)			

# **DIMENSIONS**



### SPEED FACER™ DIMENSIONS (MOUNTING RANGE: 69.2 TO 120.5)

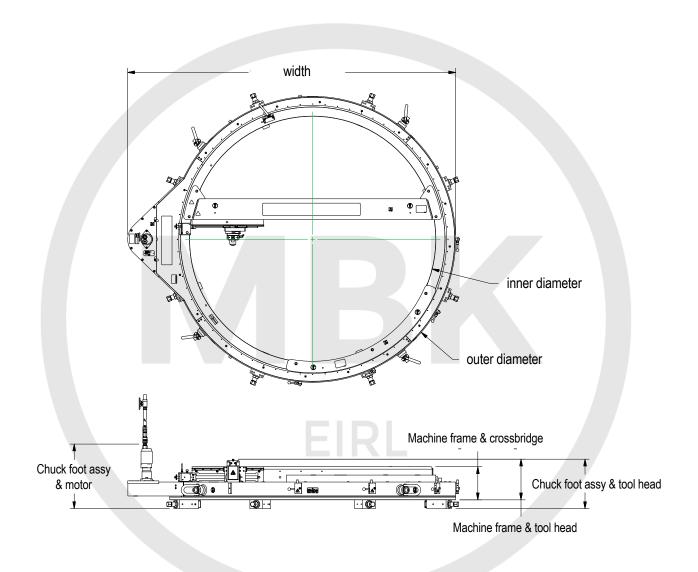


	ODF80	ODF90	ODF100	ODF110	ODF120			
Machine dimensions								
Machine width	106.1 in. (2695 mm)	116.1 in. (2949 mm)	126.1 in. (3203 mm)	136.1 in. (3457 mm)	146.1 in. (3711mm)			
Machine inner diameter	80.6 in. (2047 mm)	90.6 in. (2301 mm)	100.6 in. (2555 mm)	110.6 in. (2809 mm)	120.6 in. (3063 mm)			
Machine outer diameter	94.0 in. (2388 mm)	104.0 in. (2642 mm)	114.0 in. (2896 mm)	124.0 in. (3150 mm)	134.0 in. (3404 mm)			
Height between:	$\neg$							
Chuck foot assy & motor	18.3 in. (464.8 mm)	18.3 in. (464.8 mm) 18.5 in. (470.5 mm)						
Machine frame & crossbridge	9.3 in. (235.6 mm)	9.5 in. (241.3 mm)						
Machine frame & tool head	13.5 in. (341.9 mm)	MAC	11.7 in. (2	296.8 mm)				
Chuck foot assy & tool head	16 in. (405.4 mm)	14.2 in. (360.3 mm)						
Shipping dimensions								
Incline shipping frame W x D x H	108 x 67.6 x 73.9 in. (2743 x 1717 x 1877 mm)	118 x 74.5 x 81 in. (2997 x 1892 x 2058 mm)	128 x 81.5 x 88.2 in. (3251 x 2070 x 2240 mm)	138 x 88.4 x 95.3 in. (3505 x 2245 x 2420 mm)	148 x 95.3 x 102.4 in. (3759 x 2420 x 2601 mm)			




### Crate to cut in 15 minutes or less\*

Determine the placement of the mounting feet.
Use the chart in the manual to determine the correct position of the feet for the workpiece size.

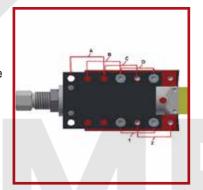

Center and level the machine on the work-piece.

The jacking foot screws will center the machine and the leveling jaw adjustment screws will level it.

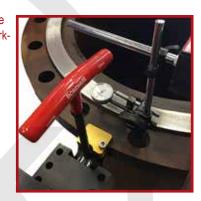

Set the jaws of the mounting feet.
Adjust the jaws of all feet to 1/8" (3mm) larger than mounting OD.



Position the cutting tool.

Insert the cutting tool and move the tool holder to the starting postion.



o.com.pe

Mount the
SpeedFacer.
Place the setup
fingers against the
mounting surface.
Tighten the jaws
evenly around the
diameter. Tighten the
jam nuts on all the
jaws.



\*Tested in a controlled environment

## **GLOBAL TRAINING CENTERS**



CLIMAX has been teaching the fundamentals and finer points of portable machine tool operation for more than 50 years.

Whether it's a regularly scheduled course at one of our seven Global Training Centers or a custom curriculum conducted with your team, at your facility, your technicians will benefit from courses developed by the most experienced and respected professionals in the business.

Regularly scheduled courses in basic and advanced tool operation are available. A vast majority of every program is devoted to hands-on activities, skills development, and OEM Certification covering the following subject matters: operator safety, tool component review, setup and mounting, standard and advanced operational techniques, overview of cutting tools and recommended usage, and maintenance procedures.



## Training is available at the following seven Global Training Centers:

- Portland, Oregon
- Houston, Texas
- Gonzales, Louisiana
- Wadsworth, Ohio


Call us today to schedule training for your team!

- Manchester, United Kingdom
- Düren, Germany
- Dubai, United Arab Emirates



H&S TOOL a CLIMAX Company Web site: climaxportable.com

## **GLOBAL LOCATIONS**

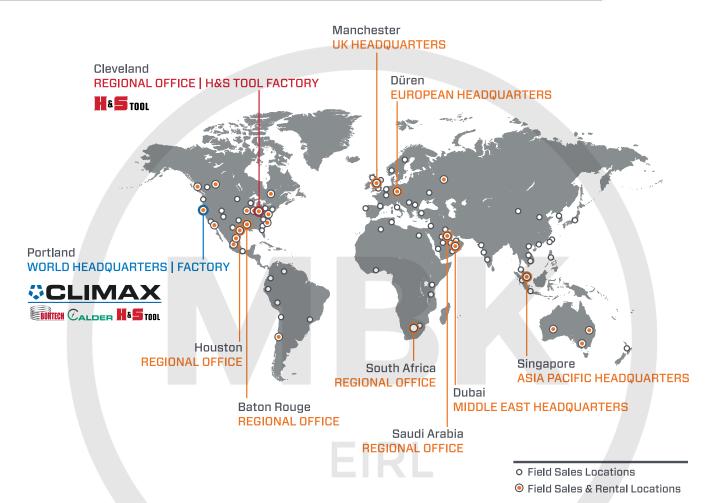

## Call CLIMAX | H&S TOOL for:

### **RENTALS**

With 20+ worldwide rental depot locations, you are never far away from a CLIMAX tool.

### **ON-SITE TRAINING**

If you need training or on-site consultation, we're famous for it!

#### **CUSTOM PROJECTS**

Custom turn-key system design services from the most experienced engineers and portable machining and welding experts!

### Connect with us: f in





#### **World Headquarters**

CLIMAX | BORTECH | CALDER Factory Address: 2712 E. 2nd St, Newberg, Oregon 97132

Tel: +1 503 538 2185 Fax: +1 503 538 7600 Email: info@cpmt.com

### Regional Office - Cleveland

**H&S TOOL Factory** 

Address: 715 Weber Dr., Wadsworth, Ohio 44281

Tel: +1 330 336 4550 Email: info@hstool.com

#### **Asia Pacific**

Address: 308 Tanglin Rd #02-01, Singapore 247974

Tel: +65 6801 0662 Fax: +65 6801 0699

Email: ClimaxAsia@cpmt.com

### European

Address: Am Langen Graben 8, 52353 Düren, Germany

Tel: (+49) (0) 2421 9177 0 Fax: (+49) (0) 2421 9177 29 Email: ClimaxEurope@cpmt.com

#### Middle East

Address: Warehouse #5, Plot: 369 272, Um Seguim

Road, Dubai, UAE Tel: +971 4 321 0328 Email: ClimaxUAE@cpmt.com

### **United Kingdom**

Address: Unit 7 Castlehill Industrial Estate, Bredbury Industrial Park, Horsfield Way, Stockport SK6 2SU

Tel: +44 (0) 161 406 1720 Email: ClimaxUK@cpmt.com

Copyright © 2019 CLIMAX Portable Machining & Welding Systems. All Rights Reserved. CLIMAX has taken reasonable measures to ensure the accuracy of the information contained in this document. However, CLIMAX makes no warranties or representations with respect to the information contained herein; and CLIMAX shall not be held liable for damages resulting from any errors or omissions herein, or from the use of the information contained in this document.

